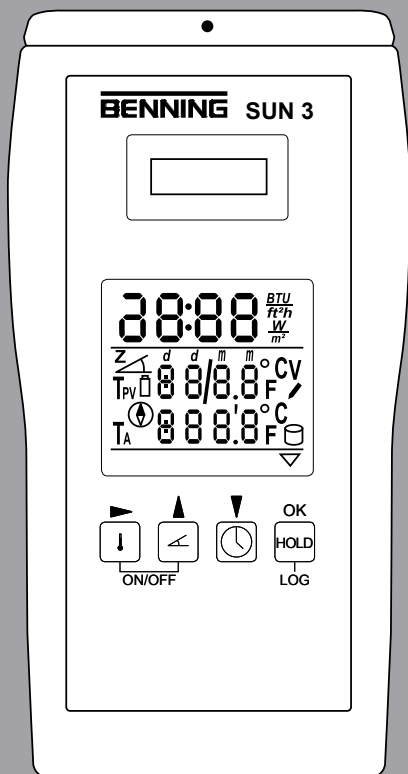


BENNING

- (D) Bedienungsanleitung
(GB) Operating manual

BENNING SUN 3

5363 / 07/2025 de_en



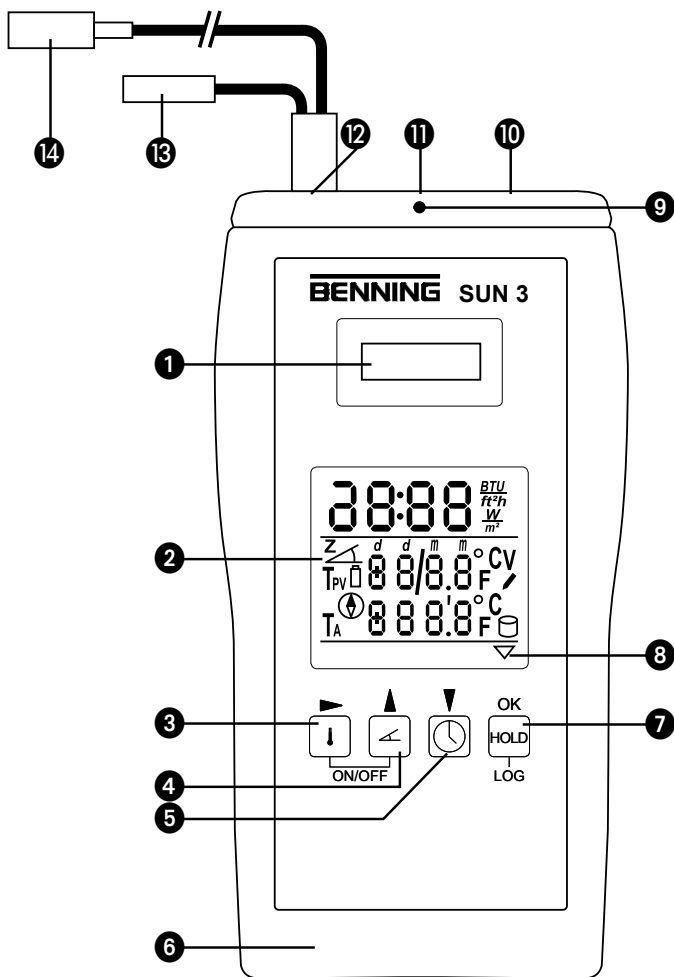


Bild 1: Gerätefrontseite
Fig. 1: Device front

Bedienungsanleitung

BENNING SUN 3

Einstrahlungs- und Temperaturmessgerät für Photovoltaik-Anlagen und thermische Solaranlagen zur Messung der

- solaren Einstrahlung (Bestrahlungsstärke)
- Modul- und Umgebungstemperatur
- Neigungswinkel
- Kompasspeilung

Inhaltsverzeichnis

1. Benutzerhinweise
2. Sicherheitshinweise
3. Lieferumfang
4. Gerätebeschreibung
5. Allgemeine Angaben
6. Umgebungsbedingungen
7. Messbereiche
8. Messen mit dem BENNING SUN 3
9. Instandhaltung
10. Umweltschutz

1. Benutzerhinweise

Diese Bedienungsanleitung richtet sich an

- ausgebildetes Fachpersonal und
- unterwiesene Personen.

Das BENNING SUN 3 ist ausschließlich zur Messung in trockener Umgebung vorgesehen (Näheres hierzu im Abschnitt 6. "Umgebungsbedingungen").

In der Bedienungsanleitung und auf dem BENNING SUN 3 werden folgende Symbole verwendet:



Warnung vor elektrischer Gefahr!

Steht vor Hinweisen, die beachtet werden müssen, um Gefahren für Menschen zu vermeiden.



Achtung Dokumentation beachten!

Das Symbol gibt an, dass die Hinweise in der Bedienungsanleitung zu beachten sind, um Gefahren zu vermeiden.



Dieses Symbol auf dem BENNING SUN 3 bedeutet, dass das BENNING SUN 3 konform zu den EU-Richtlinien ist.



Dieses Symbol auf dem BENNING SUN 3 bedeutet, dass das BENNING SUN 3 konform zu den GB-Richtlinien ist.



Dieses Symbol erscheint in der Anzeige für entladene Batterien. Sobald das Batteriesymbol erscheint, tauschen Sie umgehend die Batterien gegen neue Batterien aus.

2. Sicherheitshinweise

Das Gerät ist gemäß

DIN VDE 0411 Teil 1/ EN 61010-1 und EN IEC 61326-1

gebaut und geprüft und hat das Werk in einem einwandfreien Zustand verlassen.

Um diesen Zustand zu erhalten, muss der Anwender die Hinweise und Warnvermerke beachten, die in dieser Anleitung enthalten sind.



Verwenden Sie ausschließlich, die im Lieferumfang des BENNING SUN 3 enthaltenen Temperatursensoren und Anschlusskabel.



Die Temperatursensoren dürfen nicht an blanke, spannungsführende Teile kontaktiert werden.



Das BENNING SUN 3 ist ausschließlich zur Messung in trockener Umgebung vorgesehen.

Ist anzunehmen, dass ein korrekter Betrieb nicht mehr möglich ist, ist das Gerät außer Betrieb zu setzen.

Es ist anzunehmen, dass ein korrekter Betrieb nicht mehr möglich ist,

- wenn das Gerät oder die Anschlusskabel Beschädigungen aufweisen,
- wenn das Gerät nicht mehr arbeitet,
- nach längerer Lagerung unter ungünstigen Verhältnissen,
- nach schweren Transportbeanspruchungen,
- wenn das Gerät oder die Anschlusskabel feucht sind.

3. Lieferumfang

Zum Lieferumfang des BENNING SUN 3 gehören:

- 3.1 ein Stück BENNING SUN 3
- 3.2 ein Stück Modul-/ Umgebungstemperatursensor
- 3.3 ein Stück Gummischutzrahmen
- 3.4 ein Stück Kompakt-Schutztasche
- 3.5 ein Stück USB-Verbindungskabel (A-Stecker auf B-Stecker)
- 3.6 zwei 1,5 V Mignon/ Typ AA, IEC LR6,
- 3.7 ein Stück Kurzanleitung,

Weitere Informationen finden Sie unter: <https://tms.benning.de/sun3>

Hinweis auf Verschleißteile:

- Das BENNING SUN 3 wird durch zwei 1,5 V Mignon-Batterien gespeist (IEC LR6). Es dürfen Alkaline, wiederaufladbare NiCd oder NiMH Batterien verwendet werden.

4. Gerätebeschreibung

siehe Bild 1: Gerätefrontseite

Die in Bild 1 angegebenen Anzeige- und Bedienelemente werden wie folgt bezeichnet:

- ❶ **Einstrahlungs-Sensor** (PV-Referenzzelle), zur Messung der solaren Einstrahlung
- ❷ **Digitalanzeige**, für den Messwert, der solaren Einstrahlung, Modul-/ Umgebungstemperatur, Neigungswinkel und Kompasspeilung
- ❸ **↓-Taste**, zur Messung der Modul- und Umgebungstemperatur
- ❹ **↗-Taste**, zur Messung des Neigungswinkels und Kompasspeilung
- ❺ **🕒-Taste**, zur Anzeige/ Einstellung von Uhrzeit/ Datum
- ❻ **Batteriefach** auf der Rückseite
- ❼ **HOLD-Taste**, zum kurzzeitigen Speichern der Displayanzeige, bzw. zur Bestätigung von OK/ LOG
- ❽ **HOLD-Anzeiger**, wenn HOLD-Taste betätigt wurde
- ❾ **Markierung für Kompasspeilung**
- ❿ **USB-Schnittstelle**, zum Anschluss des USB-Verbindungskabels
- ⓫ **Buchse (Link)**, für weitere BENNING-Produkte
- ⓬ **Buchse (Probe)**, zum Anschluss der Temperatursensoren
- ⓭ **Umgebungs-Temperatursensor**
- ⓮ **Modul-Temperatursensor**
- ⓯ **Gummischutzrahmen**

5. Allgemeine Angaben

Das BENNING SUN 3 ist für die Messung der solaren Einstrahlung (Bestrahlungsstärke) sowie der Modul-/ Umgebungstemperatur von Photovoltaik-Anlagen und thermischen Solaranlagen vorgesehen. Zusätzlich beinhaltet das BENNING SUN 3 einen digitalen Kompass zur Bestimmung der Himmelsrichtung und einen Neigungswinkelmesser zur Bestimmung der Modul-/ Dachneigung.

Der integrierte Datenlogger mit Echtzeituhr ermöglicht die Speicherung von 5.000 Datensätzen, bestehend aus Bestrahlungsstärke, Modul- und Umgebungstemperatur sowie eines Zeit-/ Datumstempels. Das Messintervall des Datenloggers ist in Minutenschritten von 1 min bis 60 min

einstellbar. Die Auslesung des Datenloggers erfolgt über die integrierte USB-Schnittstelle mithilfe der BENNING Test-Equipment Cloud.

Alle Messergebnisse werden auf dem großen LCD-Display ausgegeben.

- Speicherkapazität des Datenloggers: 5.000 Datensätze, bestehend aus Bestrahlungsstärke, Modul- und Umgebungstemperatur sowie Datum-/ Zeitstempel
- Integrierte Echtzeituhr
- Schnittstelle: USB
- Geräteabmessungen:
(L x B x H) = 150 x 80 x 33 mm
- Gerätegewicht:
265 g ohne Temperaturfühler/ USB-Kabel
347 g mit Temperaturfühler/ USB-Kabel

6. Umgebungsbedingungen

- Das BENNING SUN 3 ist für Messungen in trockener Umgebung vorgesehen.
- Barometrische Höhe bei Messungen: 0 m bis maximal 2000 m
- Verschmutzungsgrad: 2
- Schutzart: IP 40 (DIN VDE 0470-1, IEC/ EN 60529)
4 - erste Kennziffer: Schutz gegen Zugang zu gefährlichen Teilen und Schutz gegen feste Fremdkörper, > 1 mm Durchmesser
0 - zweite Kennziffer: Kein Schutz gegen Wasser
- EMC: IEC/ EN 61326,
- Arbeitstemperatur und relative Luftfeuchte:
Bei Arbeitstemperatur von 0 °C bis 50 °C: relative Luftfeuchte kleiner 80 %, nicht kondensierend
- Lagerungstemperatur: Das BENNING SUN 3 kann bei Temperaturen von - 20 °C bis + 60 °C (Luftfeuchte 0 bis 80 %) gelagert werden. Dabei sind die Batterien aus dem Gerät herauszunehmen.

7. Messbereiche

Bemerkung: Die Messgenauigkeit wird angegeben als Summe aus

- einem relativen Anteil des Messwertes und
- einer Anzahl von Digit (d.h. Zahlenschritte der letzten Stelle).

Diese Messgenauigkeit gilt bei Temperaturen von 0 °C bis 50 °C und einer relativen Luftfeuchtigkeit kleiner 80 %.

7.1 Solare Einstrahlung

Messbereich	Auflösung	Messgenauigkeit
100 W/m ² - 1500 W/m ²	1 W/m ²	± (5 % + 5 Digit)
30 BTU/h/ft ² - 475 BTU/h/ft ²	1 BTU/h/ft ²	± (5 % + 5 Digit)

7.2 Modul- und Umgebungstemperatur

Messbereich	Auflösung	Messgenauigkeit
- 30 °C bis + 125 °C	1 °C	± (1 % + 1 Digit)
- 22 °F bis + 257 °F	1 °F	± (1 % + 1 Digit)

7.3 Neigungswinkel

Messbereich	Auflösung	Messgenauigkeit
0° - 80°	1°	± 2°

7.4 Kompasspeilung (Ausrichtung)

Messbereich	Auflösung	Messgenauigkeit
0° - 360°	1°	± 10°

8. Messen mit dem BENNING SUN 3

8.1 Vorbereiten der Messung

Benutzen und lagern Sie das BENNING SUN 3 nur bei den angegebenen Lager- und Arbeitstemperaturbedingungen.

- Starke Störquellen in der Nähe des BENNING SUN 3 können zu instabiler Anzeige und zu Messfehlern führen.



Vor jeder Inbetriebnahme überprüfen Sie das Gerät und die Anschlusskabel auf Beschädigungen.

8.1.1 Ein-, Ausschalten des BENNING SUN 3

- Durch gleichzeitiges Betätigen der Tasten ③ und ④ für ca. 2 Sekunden wird das BENNING SUN 3 eingeschaltet. Ein Signalton bestätigt dies. Erneutes Drücken der Tasten für > 2 Sekunden schaltet das Gerät aus.
- Das BENNING SUN 3 schaltet sich nach ca. 2 Minuten selbstständig ab (APO, Auto-Power-Off). Es schaltet sich wieder ein, wenn die Tasten ③ und ④ betätigt werden.

8.1.2 Prüfung des Batteriezustandes

- Das BENNING SUN 3 führt während des Einschaltens und im laufenden Betrieb einen automatischen Batterietest durch.
- Entladene Batterien werden durch ein Batteriesymbol  im LCD-Display dargestellt. Sobald das Batteriesymbol  erscheint sind die Batterien umgehend zu ersetzen (siehe Abschnitt 9.2)
- Zur Prüfung des Batteriezustandes drücken Sie die Taste ⑦ für > 5 s, um den Datenlogger aufzurufen. In der Digitalanzeige wird „LOG“ eingeblendet.
- Das Display zeigt wechselnd den belegten/ freien Speicher und die Batteriespannung/ das Messintervall in Minuten an.
- Sobald die Batteriespannung unter 1,8 V sinkt, tauschen Sie bitte umgehend die Batterien gegen neue Batterien aus, um Fehlmessungen zu vermeiden (siehe Abschnitt 9.2).
- Drücken Sie die Taste ③ oder ④, um den Datenlogger zu verlassen.

8.1.3 Messung der solaren Einstrahlung (Bestrahlungsstärke)

- Nach dem Einschalten des BENNING SUN 3 wird die solare Einstrahlung fortlaufend in der Digitalanzeige ② angezeigt.
- Bestrahlungsstärken unter 100 W/m² werden nicht angezeigt. Anzeige: „- - -“.
- Legen Sie das BENNING SUN 3 auf die Moduloberfläche und betätigen Sie im Bedarfsfall die -Taste ⑦ zur kurzzeitigen Speicherung des Messwertes in der Digitalanzeige.
- Zur Speicherung der solaren Einstrahlung über einen längeren Zeitraum nutzen Sie bitte den Datenlogger, wie unter Abschnitt 8.2 beschrieben.


8.1.4 Messung der Modul- und Umgebungstemperatur

- Schließen Sie den Modul-/ Umgebungstemperatursensor ⑬ ⑭ über die Buchse ⑫ an das BENNING SUN 3 an.
- Betätigen Sie die -Taste ③ zur Anzeige der Modul- (TPV) und Umgebungstemperatur (TA).
- Kontaktieren Sie den Modul-Temperatursensor ⑭ auf das PV-Modul und warten Sie bis der Temperatursensor die Temperatur des PV-Moduls angenommen hat.
- Zur Speicherung der Modul- und Umgebungstemperatur über einen längeren Zeitraum nutzen Sie den Datenlogger, wie unter Abschnitt 8.2 beschrieben.

Solare Einstrahlung ➤

PV-Modultemperatur ➤

Umgebungstemperatur ➤

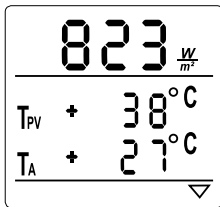


8.1.5 Messung des Neigungswinkels

- Betätigen Sie die Taste ④ zur Anzeige des Neigungswinkels und der Kompasspeilung.
- Der Neigungswinkel zur Horizontalen wird fortlaufend in der Digitalanzeige ② angezeigt.
- Legen Sie das BENNING SUN 3 auf die Moduloberfläche und betätigen Sie im Bedarfsfall die HOLD-Taste ⑦ zur kurzzeitigen Speicherung des Messwertes in der Digitalanzeige.

Solare Einstrahlung ➤

Neigungswinkel ➤

Kompasspeilung ➤

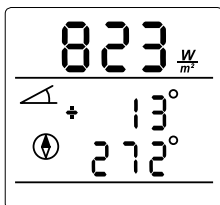

8.1.6 Nullabgleich des Neigungswinkels

- Legen Sie das Gerät auf eine ebene Fläche und drücken Sie die Taste ④ für > 5 s, bis das Symbol „Z“ in der Digitalanzeige ② blinkt.

- Drücken Sie die Taste **4** erneut, um den Wert „+SET“ zu speichern.
- Drehen Sie das Gerät um 180° und drücken Sie die Taste **4** erneut, um den Wert „-SET“ zu speichern. Der Neigungswinkel wurde auf Null abgeglichen, in der Digitalanzeige wird das Symbol „Z“ eingeblendet.
- Drücken Sie die Taste **4** erneut für > 5 s, um die Einstellung zu verlassen. Das Symbol „Z“ wird ausgeblendet.


8.1.7 Kompasspeilung (Ausrichtung)

- Betätigen Sie die Taste **4** zur Anzeige des Neigungswinkels und der Kompasspeilung.
- Die Kompasspeilung wird fortlaufend in der Digitalanzeige **2** angezeigt.
- Zur Bestimmung der Himmelsrichtung halten Sie das Gerät waagrecht. Sobald der Neigungswinkel +/- 20° überschreitet, wird die Kompasspeilung mit „- -“ angezeigt und eine Messung ist nicht möglich.
- Halten Sie die Markierung der Kompasspeilung **9** in die Richtung, die Sie bestimmen möchten. Die Richtung wird in Grad angezeigt:
0° = Norden, 90° = Osten, 180° = Süden, 270° = Westen
- Beachten Sie, dass metallische Objekte oder stromdurchflossene Leiter die Messgenauigkeit des Gerätes beeinflussen können.

Solare Einstrahlung ►

Neigungswinkel ►

Kompasspeilung ►

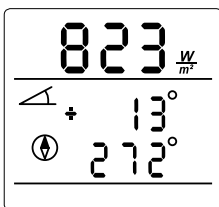


8.2 Datenlogger (Messwertspeicher) mit Echtzeituhr

Das BENNING SUN 3 kann bis zu 5.000 Datensätze, bestehend aus der solaren Einstrahlung (Bestrahlungsstärke), der Modul- und der Umgebungstemperatur, speichern. Jeder Datensatz wird mit einem Zeit-/ Datumstempel versehen. Das Messintervall (Zeitraum zwischen zwei Messungen) des BENNING SUN 3 ist in Minutenschritten von 1 min bis 60 min einstellbar.

8.2.1 Datenlogger-Setup

Das Setup ermöglicht die Einstellung des Messintervalls, des Speicher-Modus und das Löschen aller Datensätze.

- Drücken Sie die Taste **7** für > 5 s, um den Datenlogger aufzurufen. In der Digitalanzeige **2** wird „LOG“ eingeblendet.
- Das Display zeigt wechselnd den belegten/ freien Speicher und die Batteriespannung/ das Messintervall in Minuten an.
- Zur Einstellung des Messintervalls (1 min bis 60 min) drücken Sie erneut die Taste **7** für > 5 s Anzeige: „Int“. Über die Tasten **4** und **5** kann der Wert in Minutenschritten erhöht bzw. reduziert werden.
- Drücken Sie die Taste **3**, um den Speicher-Modus anzuzeigen. Anzeige: „dAtA“. Über die Tasten **4** und **5** können Sie „StOP“ (bei vollem Speicher) oder „rOLL“ (die ältesten Messwerte werden fortlaufend überschrieben) auswählen.
- Drücken Sie erneut die Taste **3**, um den Speicher zu löschen. Anzeige: „dEL“. Über die Tasten **4** und **5** können Sie „yES“ oder „nO“ auswählen, um den kompletten Speicher zu löschen.
- Über die Taste **7** (OK) kann die Einstellung jederzeit gespeichert und der Datenlogger verlassen werden.
- Drücken Sie die Taste **3** oder **4**, um den Datenlogger zu verlassen.

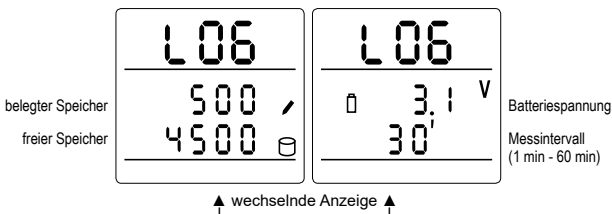

8.2.2 Datenlogger starten/ stoppen

- Drücken Sie die Taste **7** (LOG) für > 5 Sek., um den Datenlogger zu aktivieren. Anzeige: „LOG“.
- Drücken Sie erneut die Taste **7** (LOG) und anschließend die Taste **7** (OK), um „run“ zu bestätigen. Die Messwerte werden mit einem Zeit-/ Datumstempel in den internen Speicher geschrieben. Die Digitalanzeige **2** erlischt und das Gerät schaltet in den stromsparenden Bereitschaftsmodus.
- Um den Fortschritt des Datenloggers anzuzeigen, drücken Sie eine beliebige Taste. Die Digitalanzeige erwacht kurzzeitig und erlischt anschließend erneut.
- Zum Stoppen des Datenloggers drücken Sie eine beliebige Taste, um den Datenlogger anzuzeigen. Drücken Sie die Taste **7** (LOG) und anschließend die Taste **7** (OK), um „StOP“ zu bestätigen.
- Drücken Sie die Taste **3** oder **4**, um den Datenlogger zu verlassen.

8.2.3 Datenlogger mithilfe der BENNING Test-Equipment Cloud auslesen


- Die Messdaten können über die integrierte USB-Schnittstelle mithilfe der BENNING Test-Equipment Cloud (BTEC) heruntergeladen und weiterverarbeitet werden.
- Weitere Informationen dazu finden Sie unter: <https://btec-info.benning.de>

Fehlerbehebung:

- Hinweise zu möglichen Fehlerquellen finden Sie ebenfalls unter: <https://btec-info.benning.de>

8.2.4 Einstellung von Datum und Uhrzeit

- Drücken Sie die Taste **5**, um die Uhrzeit/ das Datum in der Digitalanzeige **2** anzuzeigen.
- Drücken Sie erneut die Taste **5** für > 5 s bis die Stundenanzeige blinkt.
- Die Taste-► **3** wählt das Uhrzeit/ Datums-Feld aus (Feld blinkend).
- Über die Taste-▲ **4** und ▼ **5** wird der Wert erhöht bzw. verringert.
- Drücken Sie die Taste **7** (OK), um die Einstellung zu speichern.

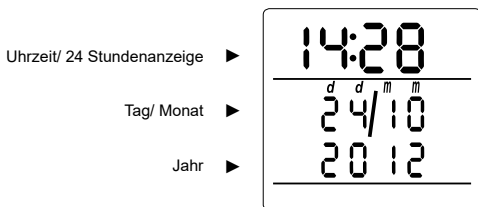

8.2.5 Anzeigeeinheit ändern

- Drücken Sie die Taste-! **3** für >5 s bis die Anzeigeeinheit der Temperatur blinkt.
- Betätigen Sie die Taste-► **3**, um die Einheit der solaren Einstrahlung oder der Temperatur auszuwählen.
- Betätigen Sie die Tasten-▲ **4** oder ▼ **5**, um zwischen den Einheiten °C oder °F bzw. zwischen W/m² oder BTU/hr/ft² zu wechseln.
- Drücken Sie die Taste **7** **HOLD** (OK), um die Einstellung zu speichern.

9. Instandhaltung

Das Gerät nicht öffnen. Es enthält keine durch den Benutzer wartbaren Komponenten. Reparatur und Service kann nur durch qualifiziertes Personal erfolgen.

9.1 Reinigung

Reinigen Sie das Gehäuse äußerlich mit einem sauberen und trockenen Tuch (Ausnahme spezielle Reinigungstücher). Verwenden Sie keine Lösungs- oder Scheuermittel, um das Gerät zu reinigen. Achten Sie unbedingt darauf, dass das Batteriefach und die Batteriekontakte nicht durch auslaufendes Batterie-Elektrolyt verunreinigt werden.

Falls Elektrolytverunreinigungen oder weiße Ablagerungen im Bereich der Batterie oder des Batteriegehäuses vorhanden sind, reinigen Sie auch diese mit einem trockenen Tuch.

9.2 Batteriewechsel

Das BENNING SUN 3 wird durch zwei 1,5 V Mignon-Batterien/ Typ AA (IEC LR6) gespeist. Ein Batteriewechsel ist erforderlich sobald die Batteriespannung unter 1,8 V sinkt (siehe Abschnitt 8.1.2).

So wechseln Sie die Batterien:

- Schalten Sie das BENNING SUN 3 aus.
- Legen Sie das BENNING SUN 3 auf die Frontseite und schieben den Batteriedeckel vom Unterteil ab.
- Heben Sie die entladenen Batterien aus dem Batteriefach.
- Legen Sie dann die Batterien in die dafür vorgesehenen Stellen im Batteriefach (achten Sie bitte unbedingt auf die korrekte Polung der Batterien).
- Schieben Sie den Batteriedeckel an das Unterteil.

9.3 Ersatzteile

Modul-/ Umgebungstemperatursensor TN: 1005 6280

Kompakt-Schutztasche TN: 1005 6270

USB-Verbindungskabel (A-Stecker auf B-Stecker) TN: 1000 8853

10. Umweltschutz



Bitte führen Sie das Gerät am Ende seiner Lebensdauer den zur Verfügung stehenden Rückgabe- und Sammelsystemen zu.

Operating Manual

BENNING SUN 3

Insolation and temperature measuring instrument for photovoltaic systems and solar thermal systems for measuring the following :

- insolation
- module temperature and ambient temperature
- angle of inclination
- compass bearing

Table of Contents

1. User instructions
2. Safety instructions
3. Scope of delivery
4. Device description
5. General information
6. Ambient conditions
7. Measuring ranges
8. Measuring with the BENNING SUN 3
9. Maintenance
10. Environmental protection

1. User instructions

This operating manual is intended for

- qualified technical personnel and
- trained personnel.

The BENNING SUN 3 is intended for measurements under dry ambient conditions only (for details, refer to section 6 "Ambient conditions").

The following symbols are used in this operating manual and on the BENNING SUN 3:



Warning of electrical danger!

Indicates instructions which must be followed to avoid danger to persons.



Attention! Please observe documentation!

The symbol indicates that the instructions in the operating manual must be observed.



This symbol on the BENNING SUN 3 means that the BENNING SUN 3 complies with the EU directives.



This symbol on the BENNING SUN 3 means that the BENNING SUN 3 complies with the UK directives.



This symbol appears on the display to indicate discharged batteries. As soon as the battery symbol appears, immediately replace the batteries by new ones.

2. Safety instructions

The instrument is built and tested in accordance with DIN VDE 0411 Part 1/ EN 61010-1 and EN IEC 61326-1

and has left the factory in perfectly safe technical condition.

To preserve this condition and to ensure safe operation of the device, the user must observe the notes and warnings given in this operating manual at all times.



Only use the temperature sensors and connecting cables included in the scope of delivery of the BENNING SUN 3.



Do not apply any electrical contact between the temperature sensors and bare live parts.



The BENNING SUN 3 is intended for measurements under dry ambient conditions only.

If it is assumed that correct operation is no longer possible, the device must be switched off immediately.

Safe operation can be assumed to be no longer possible, if

- the device or the connecting cables show visible damages,
- the device no longer works,
- the device has been stored under unfavourable conditions for a longer period of time,
- the device has been exposed to extraordinary stress during transport,
- the device or the measuring lines have been exposed to moisture.

3. Scope of delivery

The scope of delivery of the BENNING SUN 3 includes:

- 3.1 one BENNING SUN 3
- 3.2 one module / ambient temperature sensor
- 3.3 one protective rubber holster
- 3.4 one compact protective pouch
- 3.5 one USB connecting cable (A plug to B plug)
- 3.6 two 1.5 V batteries of type AA, IEC LR6,
- 3.7 one quick reference guide

Further information can be found at: <https://tms.benning.de/sun3>

Parts subject to wear:

- The BENNING SUN 3 is supplied by means of two 1.5 V batteries of type AA (IEC LR6). It is allowed to use alkaline rechargeable NiCd or NiMH batteries.

4. Device description

See figure 1: Device front

The display and operating elements shown in figure 1 are designated as follows:

- ❶ **Insolation sensor** (PV reference cell), for measuring the insolation
- ❷ **Digital display**, for displaying the measured values of insolation, module / ambient temperature, angle of inclination and compass bearing
- ❸ **↓ key**, for measuring the module temperature and ambient temperature
- ❹ **↗ key**, for measuring the angle of inclination and the compass bearing
- ❺ **⌚ key**, for displaying / setting the time / date
- ❻ **Battery compartment** on the back
- ❼ **HOLD key**, for temporary storage of the display indication or to confirm OK / LOG
- ❽ **HOLD indicator**, active when the HOLD key has been actuated
- ❾ **Marking for compass bearing**
- ❿ **USB interface**, for connecting the USB connecting cable
- ⓫ **Jack (LINK)**, for other BENNING products
- ⓬ **Jack (PROBE)**, for connecting temperature sensors
- ⓭ **Ambient temperature sensor**
- ⓮ **Module temperature sensor**
- ⓯ **Protective rubber holster**

5. General information

The BENNING SUN 3 is intended for measuring the insolation (solar irradiance) as well as the module / ambient temperature of photovoltaic systems and solar thermal systems.

Additionally, the BENNING SUN 3 comprises a digital compass for determining the cardinal direction as well as an inclinometer for determining the module / roof pitch.

The integrated data logger with real-time clock allows the storage of 5000 data records including the values for insolation, module temperature and ambient temperature as well as a time / date stamp. The measuring interval of the data logger can be set from 1 minute to 60 minutes in increments of one minute. The data of the data logger can be read out via the integrated USB interface using the BENNING Test Equipment Cloud.

All measuring results are displayed on the large LC display.

- Storage capacity of the data logger: 5000 data records, including the values for insolation, module temperature and ambient temperature as well as a time / date stamp
- integrated real-time clock
- Interface: USB
- Dimensions of the device:
(L x W x H) = 150 x 80 x 33 mm
- Weight of the device:
265 g without temperature sensors / USB cable
347 g including temperature sensors / USB cable

6. Ambient conditions

- The BENNING SUN 3 is intended for measurements under dry ambient conditions,
- Maximum barometric height for measurements: 0 m to max. 2000 m
- Contamination level: 2
- Protection category: IP 40 (DIN VDE 0470-1, IEC/ EN 60529)
4 – first index: protection against access to dangerous parts and protection against solid impurities of a diameter > 1.0 mm
0 – second index: No protection against water
- EMC: IEC/ EN 61326,
- Operating temperature and relative air humidity:
For operating temperatures from 0 °C to 50 °C: relative air humidity lower than 80 %, non-condensing
- Storage temperature: The BENNING SUN 3 can be stored at temperatures between - 20 °C and + 60 °C (air humidity 0 to 80 %). During storage, the batteries must be removed.

7. Measuring ranges

Note: The measuring accuracy is specified as the sum of:

- a relative part of the measured value and
- a number of digits (i.e. counting steps of the last digit).

This measuring accuracy applies to temperatures from 0 °C to 50 °C and a relative air humidity lower than 80 %.

7.1 Insolation

Measuring range	Resolution	Measuring accuracy
100 Wm ² to 1500 Wm ²	1 W/m ²	± (5 % + 5 digits)
30 BTU/h/ft ² to 475 BTU/h/ft ²	1 BTU/h/ft ²	± (5 % + 5 digits)

7.2 Module temperature and ambient temperature

Measuring range	Resolution	Measuring accuracy
- 30 °C to + 125 °C	1 °C	± (1 % + 1 digit)
- 22 °F to + 257 °F	1 °F	± (1 % + 1 digit)

7.3 Angle of inclination

Measuring range	Resolution	Measuring accuracy
0° to 80°	1°	± 2°

7.4 Compass bearing (orientation)

Measuring range	Resolution	Measuring accuracy
0° to 360°	1°	± 10°

8. Measuring with the BENNING SUN 3

8.1 Preparing the measurement

Operate and store the BENNING SUN 3 at the specified storage and operating temperatures only!

- Strong sources of interference in the vicinity of the BENNING SUN 3 might involve unstable readings and measuring errors.



Before commissioning, always check the device as well as all connecting cables for damages.

8.1.1 Switching the BENNING SUN 3 ON/OFF

- Press the keys **3** and **4** at the same time for approx. 2 seconds to switch the BENNING SUN 3 on. This will be confirmed by an acoustic signal. Press the keys again for > 2 seconds to switch the device off.
- The BENNING SUN 3 is switched off automatically after approx. 2 minutes (**APO**, **Auto-Power-Off**). It switches on again when the keys **3** and **4** are actuated.

8.1.2 Testing the battery condition


- During switch-on and operation, the BENNING SUN 3 carries out an automatic battery test.
- Discharged batteries are indicated by a battery symbol  on the LC display. As soon as the battery symbol  appears, the batteries have to be replaced by new ones immediately (see section 9.2).
- For testing the battery condition, press the key **7** for > 5 seconds to call the data logger. "LOG" appears on the digital display.
- Alternately, the display shows the occupied / free memory space as well as the battery voltage / the measuring interval in minutes.
- As soon as the battery voltage falls below 1.8 V, immediately replace the batteries by new ones in order to prevent incorrect measurements (see section 9.2).
- Press the key **3** or **4** to exit the data logger.

8.1.3 Measuring the insolation (solar irradiance)

- After having switched the BENNING SUN 3 on, the insolation is displayed continuously on the digital display **2**.
- Solar irradiance below 100 W/m² are not indicated. Display: "- - -".
- Place the BENNING SUN 3 onto the surface of the photovoltaic module and press the  key **7**, if necessary, to store the measured value temporarily in the digital display.
- To store the insolation value for a longer period of time, please use the data logger as described in section 8.2.


8.1.4 Measuring the module temperature and the ambient temperature

- Connect the module / ambient temperature sensor **13** **14** to the BENNING SUN 3 by means of the jack **12**.
- Press the  key **3** to display the module temperature (TPV) and the ambient temperature (TA).
- Bring the module temperature sensor **14** into contact with the PV module and wait until the temperature sensor has measured the temperature of the PV module.
- To store the module temperature and ambient temperature values for a longer period of time, please use the data logger as described in section 8.2.

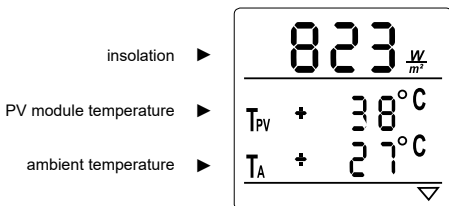

8.1.5 Measuring the angle of inclination

- Press the key **4** to display the angle of inclination and the compass bearing.
- The angle of inclination with respect to the horizontal is indicated continuously on the digital display **2**.
- Place the BENNING SUN 3 onto the surface of the photovoltaic module and press the HOLD key **7**, if necessary, to store the measured value temporarily in the digital display.

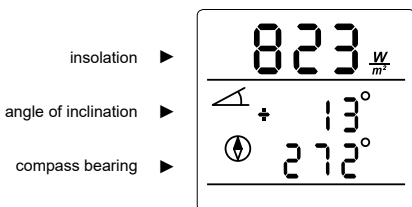


8.1.6 Null balance of the angle of inclination

- Place the device onto a plane surface and press the key **4** for > 5 seconds until the "Z" symbol starts flashing on the digital display **2**.
- Press the key **4** again to store the "+SET" value.
- Turn the device by 180° and press the key **4** again to store the "-SET" value. The angle of inclination has been balanced to null and the "Z" symbol is shown on the digital display.
- Press the key **4** again for > 5 seconds to exit the setting. The "Z" symbol disappears from the LC display.

8.1.7 Compass bearing (orientation)

- Press the key **4** to display the angle of inclination and the compass bearing.
- The compass bearing is indicated continuously on the digital display **2**.
- To determine the cardinal direction, hold the device horizontally. As soon as the angle of inclination exceeds +/- 20°, the compass bearing indication shows "- - -" and it is not possible to take a bearing.
- Hold the marking **9** for the compass bearing in the direction which you would like to determine. The direction is displayed in degrees:
0° = North, 90° = East, 180° = South, 270° = West
- Please observe that metallic objects or live conductors might affect the measuring accuracy of the device.

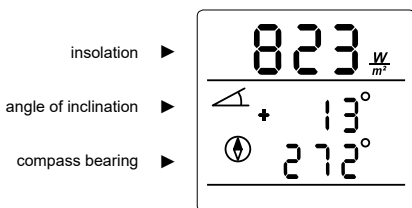


8.2 Data logger (measured value memory) with real-time clock

The BENNING SUN 3 can store up to 5000 data records consisting of the values for insolation (solar irradiance), module temperature and ambient temperature. Each data record will be provided with a time / date stamp. The measuring interval (time between two measurements) of the BENNING SUN 3 can be set from 1 minute to 60 minutes in increments of one minute.

8.2.1 Data logger set-up

The set-up allows the user to set the measuring interval, the memory mode and to delete all data records.

- Press the key **7** for > 5 seconds to call the data logger. "LOG" appears on the digital display **2**.
- Alternately, the display shows the occupied / free memory space as well as the battery voltage / the measuring interval in minutes.
- To set the measuring interval (1 minute to 60 minutes), press the key **7** again for > 5 seconds. Display: "Int". Press the key **4** or key **5** to increase or decrease the value in increments of one minute.
- Press the key **3** to display the memory mode. Display: "dAtA". Press the key **4** or key **5** to select "STOP" (if the memory is full) or "rOLL" (if you want to overwrite the oldest measured values continuously).
- Press the key **3** again to delete the memory. Display: "dEL". Select "yES" or "nO" by pressing the **4** or **5** keys to delete the entire memory.
- By means of the key **7** (OK), it is possible to store the setting at any time and to exit the data logger.
- Press the key **3** or **4** to exit the data logger.

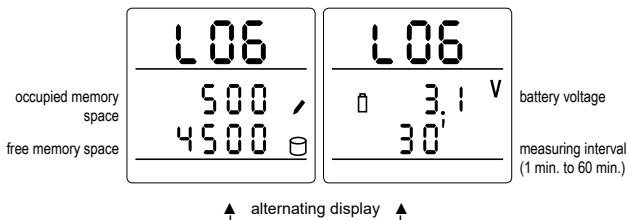

8.2.2 Starting / stopping the data logger

- Press the key **7** (LOG) for > 5 seconds to activate the data logger. Display: "LOG".
- Press the key **7** (LOG) again and then the key **7** (OK) to confirm "run". The measured values are written into the internal memory including a time / date stamp. The digital display **2** goes out and the device switches over into the energy-saving stand-by mode.
- Press any key to display the progress of the data logger. The digital display briefly goes on and then goes out again.
- If you want to stop the data logger, press any key to display the data logger. Press the key **7** (LOG) and then the key **7** (OK) to confirm "StOP".
- Press the key **3** or **4** to exit the data logger.

8.2.3 Read out data loggers using the BENNING Test Equipment Cloud


- The measurement data can be downloaded and further processed via the integrated USB interface using the BENNING Test Equipment Cloud (BTEC).
- Further information can be found at: <https://btec-info.benning.de>

Troubleshooting:

- You can also find information on possible sources of error at: <https://btec-info.benning.de>

8.2.4 Setting the date and the time

- Press the key **5** to display the time / date on the digital display **2**.
- Press the key **5** again for > 5 seconds until the hour display starts flashing.
- Press the **▶** key **3** to select the time / date field (field is flashing).
- Press the **▲** key **4** or **▼** key **5** to increase or decrease the value.
- Press the key **7** (OK) to store the setting.

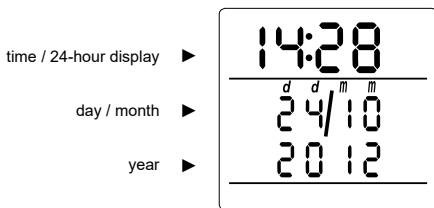

8.2.5 Changing the displayed unit

- Press the **1** **3** key for > 5 seconds until the displayed temperature unit starts flashing.
- Press the **▶** **3** key to select the respective unit for insolation or temperature.
- Press the **▲** **4** or **▼** **5** key to change between the units °C or °F or between the units W/m² or BTU/hr/ft².
- Press the **7** **HOLD** key (OK) to store the setting.

9. Maintenance

Do not open the device. It does not contain any components requiring maintenance by the user. Repair and service must be carried out by qualified personnel only!

9.1 Cleaning

Clean the exterior of the device with a clean dry cloth (exception: special cleaning wipers). Do not use any solvents or abrasives to clean the device. Make sure that the battery compartment and the battery contacts are not contaminated by leaking battery electrolyte.

If there are electrolyte contamination or white deposits in the area of the battery or the battery housing, clean these areas as well by means of a dry cloth.

9.2 Battery replacement

The BENNING SUN 3 is supplied by means of two 1.5 V batteries of type AA (IEC LR6).

It is necessary to replace the batteries as soon as the battery voltage falls below 1.8 V (see section 8.1.2).

Proceed as follows to replace the battery:

- Switch the BENNING SUN 3 off.
- Put the BENNING SUN 3 face down and slide the battery compartment cover off the bottom part of the device.

- Remove the discharged batteries from the battery compartment.
- Then, insert the batteries into the battery compartment at the provided places (please observe correct polarity of the batteries).
- Slide the battery compartment cover back onto the bottom part of the device.

9.3 Calibration

To maintain accuracy of the measuring results, the device must be recalibrated in regular intervals by our factory service. We recommend recalibrating the device once a year. For this purpose, send the device to the following address:

Benning Elektrotechnik & Elektronik GmbH & Co. KG
Service Center
Robert-Bosch-Str. 20
D – 46397 Bocholt

9.4 Spare parts

Module / ambient temperature sensor	part no.: 1005 6280
Compact protective pouch	part no.: 1005 6270
USB connecting cable (A plug to B plug)	part no.: 1000 8853

10. Environmental protection



At the end of product life, dispose of the unserviceable device via appropriate return or collecting facilities provided in your community.

Benning Elektrotechnik & Elektronik GmbH & Co. KG
Münsterstraße 135 - 137
D - 46397 Bocholt
Phone: +49 (0) 2871-93-0 • Fax: +49 (0) 2871-93-429
www.benning.de • E-Mail: duapol@benning.de